

2014  
VG-n 2



# Vehicle Inspection Report

**Please Review This Important Information**

Your vehicle has **FAILED** its MASSACHUSETTS COMMERCIAL MOTOR VEHICLE SAFETY TEST and **PASSED** its EMISSIONS TEST. Here is what you need to do now:

- \* Fix safety defects immediately. Do not drive your vehicle until repairs are made.
- \* Have your repaired vehicle re-tested within 60 days of your initial inspection. The first re-test is free at the original inspection station during this period. The last day for your free re-test is 6/18/2023.
- \* Pass your re-test and get a new inspection sticker.
- \* If your vehicle does not pass a re-test within 60 days of its initial inspection, RMV may suspend your registration.

Keep a copy of this Report with the vehicle, as required by the Federal Motor Vehicle Safety Regulations for Inspection, Repair and Maintenance (49 CFR 396.21).

Questions? Visit [www.mass.gov/vehiclecheck](http://www.mass.gov/vehiclecheck) or call Customer Service at 844-358-0135. Customer Service is staffed from 7 a.m. to 5 p.m. Monday through Friday and from 7 a.m. to Noon on Saturday.

Overall Result:	FAIL	Vehicle Information		Station Information	
Safety Result	FAIL	VIN	1FDEE3FL5EDA34344	F. BREWER INSPECTIONS	
Emissions Result	PASS	License Plate	M92009	126 GRANITE STREET	
Start Test Date/Time	4/19/2023 1:41 PM	Plate Type/State	MVN / MA	ROCKPORT	MA
End Test Date/Time	4/19/2023 2:14 PM	Vehicle Type	BUS	(978) 810-0926	
Test Type	Regular	Year / Make	2014 Ford		
Sticker Number	241304597	Model	E-Series Chassis	Station Number	PB050213
Inspection Type	Initial	Fuel Type	FLEXIBLE	Workstation Number	MAW00001736
Inspection Counter	1	Engine Cyl / Size	8 / 5.4L	Inspector Number	****3575
		GVWR	14000		
		Odometer	104260		

**See Page 2 of this report for:**  
Commercial Vehicle Safety Results


Base Inspection Fee	\$35.00
Station Labor Rate	\$145.00 per hour
Inspection Time	1 hour(s)
<b>Total Inspection Fee</b>	<b>\$180.00</b>

On-Board Diagnostic (OBD) Results		OBD Readiness Monitor Results		OBD Additional Data	
Tampering Check	PASS	Catalyst	READY	Miles Since Code Clearing	10809
Connector Result	PASS	Catalyst Heater	UNSUPPORTED	Warm-Ups Since Code Clearing	209
RPM Result	PASS	Evaporative System	READY	Pin 16 Voltage	14.3
Key-On BulbCheck	N/A	Secondary Air System	UNSUPPORTED	<b>OBD Diagnostic Trouble Codes</b>	
Engine-Running Bulb Check	N/A	A/C System	UNSUPPORTED		
Scan Tool Check	N/A	Oxygen Sensor	READY		
Communication Result	PASS	Oxygen Sensor Heater	READY		
MIL Status Result	PASS	EGR and/or VVT System	UNSUPPORTED	<b>OBD Permanent Fault Codes</b>	
Readiness Result	PASS				

VIR Number



Scan to visit website:

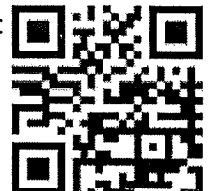

**Motor Carrier and Vehicle Information**

VIN 1FDEE3FL5EDA34344

License Plate M92009

Start Test Date/Time 4/19/2023 1:41 PM

Plate Type / State MVN / MA

Motor Carrier MANCHESTER COA

*Van 2  
2014***Safety Inspection Results**

License Plate	FAIL	Chock Blocks	PASS	Splash Guards	PASS
Horn	PASS	Warning Devices	PASS	Bumpers	PASS
Fenders	PASS	Fenders - Trailer	N/A	Seat Belts	PASS
Air Bags	PASS	Mirrors	PASS	Air Brake Sys - Leakage Test	N/A
Air Brake Sys - Low Pres Warning Dev	N/A	Air Brake Sys - Cond of Components	N/A	Brake System - Service Brakes	FAIL
Brake System - Parking Brake System	PASS	Brake System - Drums/Rotors	PASS	Brake System - Hoses	PASS
Brake System - Tubing	PASS	Brake System - Low Pres Warning Dev	PASS	Brake System - Tractor Protect Valve	N/A
Brake System - Air Compressor	N/A	Brake System - Hydraulic Brakes	PASS	Brake System - Vacuum Brakes	PASS
Coupling Devices - Fifth Wheel	N/A	Coupling Devices - Pintle Hooks	N/A	Coupling Devices - Drawbar/Towbar	N/A
Coupling Device - Drawbar/Towbar Tong	N/A	Coupling Devices - Safety Devices	N/A	Coupling Devices - Saddle Mounts	N/A
Coupling Devices	N/A	Exhaust System - Leak	PASS	Exhaust System - Leak Forward/Below C	PASS
Exhaust System - Bus Exhaust Leak	PASS	Exhaust System - Location	PASS	Exhaust System - Visible Smoke	PASS
Fuel System - Leak	PASS	Fuel System - Filler Cap	PASS	Fuel System - Tank	PASS
Lighting Devices	PASS	Reflectors and Reflective Tape	PASS	Safe Loading	PASS
Steering - Steering Wheel Free Play	PASS	Steering - Steering Column	PASS	Steering - Front Axle Beam & Oth Comp.	PASS
Steering - Gear Box	PASS	Steering - Pitman Arm	PASS	Steering - Power Steering	PASS
Steering - Ball/Socket Joints	PASS	Steering - Tie Rods and Drag Links	PASS	Steering - Fasteners	PASS
Steering - Steering System	PASS	Steering - Kingpin	N/A	Suspension - Axle Positioning Parts	PASS
Suspension - Spring Assembly	PASS	Suspension - Torque/Rad/Tracking Com	PASS	Suspension - Shocks	PASS
Frame - Frame Members	PASS	Frame - Tire and Wheel Clearance	PASS	Frame - Adjustable Axle Assembly	N/A
Driveshaft Protection - Bus Only	N/A	Tires - Steering Axle Tires	PASS	Tires - Non-Steering Axle Tires	FAIL
Wheels and Rims - Locking or Side Ring	PASS	Tires	PASS	Wheels and Rims	PASS
Wheels and Rims - Fasteners	PASS	Wheels and Rims - Welds	PASS	Windshield - Critical Viewing Area	PASS
Windshield - Defects	PASS	Window Tint	PASS	Windshield Wipers - Condition	PASS
Windshield Wipers - Operation	PASS	Windshield Wipers - Cleaner Equipment	PASS	Other	N/A

**Inspection Comments**

RIGHT REAR TIRE(INNER SIDEWALL). REAR BRAKES. BOTH LIC PLATES.

**Inspection Certification**

I certify the accuracy and completeness of this inspection as complying with all the requirements of the Federal Motor Carrier Safety Administration set forth in 49CFR 396.21



Signature of Inspector Francis Brewer