

**Northeast Diesel LLC**

319 Route 81 Bldg B

Killingworth, CT. 06419

Phone: 860-575-2642 Fax: 860-452-4481

'YOUR POWER IS OUR PASSION'

**INVOICE****3635**

Org. Est. # 003635

**INVOICE**

Printed Date: 06/12/2023

**Killingworth Amb. - James Fretz**

PO Box 749

Killingworth, CT 06419

Home 203-421-4040 James 860-759-0196

Office 203-710-2456 Dan

2009 Dodge - Ram - 4500 - Cummins 6.7L ETJ 6 CYL

Lic # : AB30174

Odometer In : 118989

VIN # : 3D6WD66L5 9G542636

Part Description	Qty	Sale	Ext	Labor Description	Ext
Full Syn. Power Steering	2.00	10.05	20.10	Power Steering Pump	667.95
Steering Damper	1.00	277.44	277.44	Customer states wheel wonders or over steers after the previous front end repairs were made. The tires were rotated and the ambulance is very top heavy so the counter steer will be more aggressive. Replaced the power steering pump assembly, and the intermediate steering shaft had hard spots in it. Showed the customer the parts being replaced. These steering parts are discontinued from dealer and parts are not readily available in after market. We will still try to find a steering box for chassis, once that is done the truck will have to go alignment.	
Shipping / Freight	1.00	61.52	61.52		
Power-Steering Pump W/ Reservoir	1.00	428.78	428.78		
Intermediate Steering Shaft	1.00	250.90	250.90		
Shop Supplies			71.85		
				Hazardous Materials	9.67

Org. Estimate 1,901.76 Revisions 0.00 Current Estimate 1,901.76

Labor:	667.95
Parts:	1,110.59
HazMat:	9.67
SubTotal:	1,788.21
Tax:	113.55
Total:	1,901.76
Bal Due:	\$1,901.76

[ Payments - ]

Vehicle Received:

Customer Number : 145

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

PAYMENT: Will be collected for truck repair upon receiving invoice, unless otherwise discussed with customer and owner before work is started and completed, 30 day house accounts for towns and other non profit organizations and contractors can be opened upon approval of owner prior to repair.

WARRANTY: The warranty on the work done this facility is covered for 1 year parts and labor, if a customer provides there own parts, the labor warranty is void and is NOT covered if the part fails, labor warranty is only covered if the part is purchased in house.

Part and Truck Disclaimers: All Parts removed will be discarded unless instructed otherwise. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO TRUCK OR ARTICLES LEFT IN TRUCKS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Signature \_\_\_\_\_

Date \_\_\_\_\_

6-12-2023

Email Address: [northeastdiesel@outlook.com](mailto:northeastdiesel@outlook.com)

P.1



Thoroughbred Performance  
Products Inc  
4793 Rockwell Road  
Winchester KY 40391  
United States

Invoice  
#INV286504  
06/19/2023

**Bill To**

James Fretz  
9 PHEASANT RUN RD  
Killingworth CT 06419  
United States

**Ship To**

North East Diesel  
James Fretz  
319 route 81 unit B  
Killingworth CT 06419  
United States

**TOTAL**

**\$1,133.69**

**Terms****PO #****Sales Rep**

Ariana Thomas

**Shipping Method**

UPS® Ground

**Partner**


Quantity	Item	Options	Unit Price	Amount
1	<b>RHGTAS35-CRED</b> RedHead Steering Gears - Steering Gear Box - 08-12 Dodge Cummins 4500/5500			
1	<b>RHGTAS35</b> RedHead Steering Gears - Steering Gear Box - 08-12 Dodge Cummins 4500/5500		\$916.00	\$916.00
1	<b>CRERHG500-1D</b> Red Head \$500 Deferred Core Charge		\$0.00	\$0.00
				\$916.00
1	<b>EXDTELESALES</b> Extend 2yr Protection Plan   RHGTAS35-CRED		\$99.99	\$99.99

**Subtotal** \$1,015.99

**Tax Total** \$67.70

**Shipping Cost** \$50.00

**Total** \$1,133.69



INV286504

CALL FOR FREE ADVICE (TEL:18597374966)

(TEL:18597374966)


P.2

EMAIL: (MAILTO:SALES@THOROUGHBREDDIESEL.COM)



(<https://www.thoroughbreddiesel.com/>)

Home > Shop by Department > Performance > Drive Line > Steering Gear > (Red Head Steering Gears - Steering Gear Box - 08-12 Dodge Cummins 4500/5500)

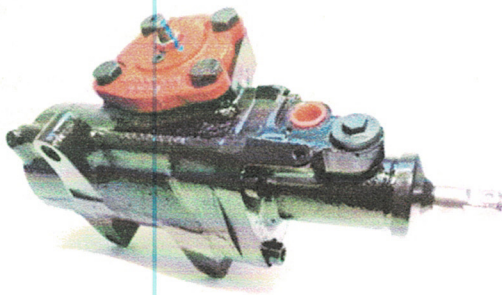

ORDERED 6/19/23  
TALKED W/ ADRIANA  
TOTAL 1133.69  
SHIPPED TO N.E. DIESEL

**REDHEAD**  
STEERING GEARS



WATCH PRODUCT VIDEO

## RedHead Steering Gears - Steering Gear Box - 08-12 Dodge Cummins 4500/5500

Thoroughbred Sku #: RHGTAS35-CRE

### ITEM OPTIONS:

Documents - PDF: [red-head-remanufactured-steering-gear.pdf \(/assets/1/pdf/red-head-remanufactured-steering-gear.pdf\)](#)



**Product Name:** RedHead Steering Gears - Steering Gear Box

**Manufacturer:** RedHead Steering Gears

**Manufacturer Part #:** TAS35

**Thoroughbred Diesel Part #:** RHGTAS35

**Fitment Notes:** 2008-2012 Dodge Cummins 4500/5500

RedHead replacement steering gear box for Dodge Diesels! No, this is not just another rebuilt box like what you'll get at your local auto parts store! These steering boxes are built in Washington state and offer unmatched steering control and longevity.

This gearbox allows you to retain the factory steering shaft, as well as the stock pitman arm. This is a major advantage especially those with lifted trucks with dropped pitman arms, you will not have to change your pitman arm.

**RedHead Steering Gears Features:**

- 12 Month Warranty
- Built in the USA
- Housings are machined out and replaced with needle bearings
- Shafts are flame sprayed or replaced as needed
- New control valves installed on some applications
- Worm and piston assembly are custom fit with special ordered, precise oversized ball bearings
- Sector shafts are installed on a lathe to confirm they are straight and true
- Sealing surface is polished to avoid any leaks
- Gear has 3 master spline output shaft
- For more on RedHead Steering Gears call us at **1-859-737-4966 (tel:1-859-737-4966)**.



**Newsletter Signup**

Get the latest news and offers from Thoroughbred Diesel.

Enter Email Address...

SUBMIT



P.4

# Proof of Delivery

Dear Customer,

This notice serves as proof of delivery for the shipment listed below.

**Tracking Number**

1Z8435749091256437

**Weight**

46.00 LBS

**Service**

UPS Ground

**Shipped / Billed On**

06/19/2023

**Delivered On**

07/11/2023 9:10 A.M.

**Received By**

FOX

**Delivered To**

POST FALLS, ID, US

Please print for your records as photo and details are only available for a limited time.

Sincerely,

UPS

Tracking results provided by UPS: 07/11/2023 4:44 P.M. EST

**Northeast Diesel LLC**

319 Route 81 Bdlg B

Killingworth, CT. 06419

Phone: 860-575-2642 Fax: 860-452-4481

'YOUR POWER IS OUR PASSION'

**INVOICE****2360**

Org. Est. # 002915

**Invoice from History**

Printed Date: 02/08/2024

Work Completed: 02/10/2022

**Killingworth Amb. - James Fretz**

PO Box 749

Killingworth, CT 06419

Home 203-421-4040 Jim 860-759-0196

Office 203-710-2456 Dan

2009 Dodge - Ram - 4500 - Cummins 6.7L ETJ 6 CYL

Lic # : AB30174

Odometer In : 100889

VIN # : 3D6WD66L5 9G542636

Part Description	Qty	Sale	Ext	Labor Description	Ext
HD High Output 220 Ambulance Alternator	1.00	419.87	419.87	Check Dash Board Alarm And Burning Smell	486.27
Serpentine Belt	1.00	79.86	79.86	Customer dropped ambulance off for alarm and burning smell. After inspection found alternator internally shorted out and melting and burning. Bring truck inside and disconnect all batteries to stop short. Inspect all wiring and fuse able links to make sure nothing melted when alternator shorted out. All wiring checked out good. Clean all terminal ends for alternator, replace with new updated high output 220 unit. WHILE system was apart found belt had wear on it. Replace belt and run engine to check for proper charging and function.	9.67
Shop Supplies			39.24	Hazardous Materials	

[ Payments - Check (#5895) - \$1,034.91 ]

**NORTHEASTDIESEL@OUTLOOK.COM**

PAYMENT: Will be collected for truck repair upon receiving invoice, unless otherwise discussed with customer and owner before work is started and completed, 30 day house accounts for towns and other non profit organizations and contractors can be opened upon approval of owner prior to repair.

Part and Truck Disclaimers: All Parts removed will be discarded unless instructed otherwise. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO TRUCK OR ARTICLES LEFT IN TRUCKS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Vehicle Received: 2/10/2022

Labor:	486.27
Parts:	538.97
HazMat:	9.67
Sub:	1,034.91
Tax:	0.00
Total:	\$1,034.91
Bal Due:	\$0.00

Customer Number : 145

Signature \_\_\_\_\_

Date \_\_\_\_\_

Email Address: **northeastdiesel@outlook.com**

Eastford Fire & Rescue Sales, Inc.

P.O. Box 68  
10 Westford Rd.  
Eastford, CT 06242

# Invoice

Date	Invoice #
10/5/2023	23144

Bill To
Killingworth Ambulance P.O. Box 749 Pond Meadow Road Killingworth, CT 06419

P.O. No.	Terms	Unit#	Mileage
	Net 30		125,048

Item	Qty	Description	Rate	Amount
100	2.5	Rear blower motor not working. Internal failure of blower motor. Replaced blower motor and verified proper operation. Also found kinked heater hose under hood. Replaced section of hose with union and hose clamps.	189.00	472.50
26060048A	1	A/C blower motor	499.79	499.79
28410	1	5/8 heater hose	5.67	5.67
28604	1	Union-5/8	6.54	6.54
10	3	Hoseclamps	1.08	3.24
Shop Supplies	1	Shop Supplies and Waste Disposal Fee	12.95	12.95
Pick up and Deliv...	1	No charge for pick up and delivery	0.00	0.00

			<b>Subtotal</b>	\$1,000.69
We now accept all major credit cards. Contact us at 860-974-1718 for more information. As always, thank you for your business			<b>Sales Tax (6.35%)</b>	\$0.00
			<b>Total</b>	\$1,000.69
			<b>Payments/Credits</b>	\$0.00
			<b>Balance Due</b>	\$1,000.69

Phone #	Fax #	E-mail
860-974-1718	860-974-3564	efr@eastfordtruck.com



**Northeast Diesel LLC**

319 Route 81 Bldg B

Killingworth, CT. 06419

Phone: 860-575-2642 Fax: 860-452-4481

'YOUR POWER IS OUR PASSION'

**INVOICE****3767**

Org. Est. # 003767

**INVOICE**

Printed Date: 09/08/2023

**Killingworth Amb. - James Fretz**

PO Box 749

Killingworth, CT 06419

Home 203-421-4040 Jim 860-759-0196

Office 203-710-2456 Dan

2009 Dodge - Ram - 4500 - Cummins 6.7L ETJ 6 CYL

Lic # : AB30174

Odometer In : 124043

VIN # : 3D6WD66L5 9G542636

Part Description	Qty	Sale	Ext	Labor Description	Ext
Oil Filter	1.00	25.48	25.48	PM Service / Check Engine Light	237.89
EC1 Antifreeze	0.50	20.06	10.03	Change oil, oil filter, checked air filter, check all fluids, grease truck.	
Engine Oil	12.00	8.81	105.72	Check computer for codes per customer request. System stored	
Shop Supplies			15.96	codes for a exhaust sensor and fuel rail pressure. Cleared codes	
				and when light comes back on will check to see which issue stores	
				first and address it as it comes.	
				Hazardous Materials	9.67

Org. Estimate 430.45 Revisions 0.00 Current Estimate 430.45

Labor:	237.89
Parts:	157.19
HazMat:	9.67
SubTotal:	404.75
Tax:	25.70
Total:	430.45
Bal Due:	\$430.45

[ Payments - ]

Vehicle Received:

Customer Number : 145

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

PAYMENT: Will be collected for truck repair upon receiving invoice, unless otherwise discussed with customer and owner before work is started and completed, 30 day house accounts for towns and other non profit organizations and contractors can be opened upon approval of owner prior to repair.

WARRANTY: The warranty on the work done this facility is covered for 1 year parts and labor, if a customer provides there own parts, the labor warranty is void and is NOT covered if the part fails, labor warranty is only covered if the part is purchased in house.

Part and Truck Disclaimers: All Parts removed will be discarded unless instructed otherwise. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO TRUCK OR ARTICLES LEFT IN TRUCKS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Signature \_\_\_\_\_ Date \_\_\_\_\_

Email Address: [northeastdiesel@outlook.com](mailto:northeastdiesel@outlook.com)

**Northeast Diesel LLC**

319 Route 81 Bldg B

Killingworth, CT. 06419

Phone: 860-575-2642 Fax: 860-452-4481

'YOUR POWER IS OUR PASSION'

**INVOICE****3538**

Org. Est. # 003538

*P.1***INVOICE**

Printed Date: 05/18/2023

**Killingworth Amb. - James Fretz**

PO Box 749

Killingworth, CT 06419

Home 203-421-4040 James 860-759-0196

Office 203-710-2456 Dan

2009 Dodge - Ram - 4500 - Cummins 6.7L ETJ 6 CYL

Lic #: AB30174

Odometer In : 116569

VIN #: 3D6WD66L5 9G542636

Part Description	Qty	Sale	Ext	Labor Description	Ext
Front Coated Brake Rotors	2.00	405.64	811.28	Front Brakes	402.11
Front Emergency Rated Brake Pads	1.00	247.61	247.61	Replace front pads and rotors, clean and free up all slides and brackets. Right front had a tight wheel bearing on assembly, called customer and advised to at least change the one bearing. On steer axle it is best to change both especially on a emergency vehicle.	
Rear Coated Brake Rotors	2.00	274.73	549.46	Customer approved both bearings. Replaced with new updated heavy fleet coated bearings. Prep area for axle joints and ball joints.	
Rear Emergency Rated Brake Pads	1.00	247.61	247.61	Rear Brakes	801.54
HD Steering Damper	1.00	140.10	140.10	Completely take apart rear axle brakes. Extra time is needed for brakes on rear of a ambulance because the calipers do not clear the on spot chains. Replace all seals, replace pads rotors, and gear oil.	
Front Upper Ball Joint	2.00	208.03	416.06	Take apart calipers and clean all slides and moving parts. Clean and adjust rear emergency brakes with new pads and rotors. Road test and top off gear oil.	
Front Lower Ball Joint	2.00	171.06	342.12	Coolant Leak	201.72
Front Axle U-Joints	2.00	230.35	460.70	Performed coolant pressure test, located leaking coolant hose from the heater core to the rear body. Removed leaking hose, cleaned area and installed new silicone hose and clamps. Filled coolant and did pressure test and checked for leaks, all ok.	
Front Sway Bar Bushing Kit	2.00	144.40	288.80	Front Sway Bar Bushings	133.59
Front Wheel Bearing Assembly	2.00	369.87	739.74	Drop front sway bar down and replace both front sway bar bushings.	
Outer Axle Flange O-Ring	2.00	23.57	47.14	Front Axle U-Joints	467.57
Rear Axle Wheel Seal	2.00	54.65	109.30	While brakes were apart, press out seizing u-joints. Clean all rust and debris from both housing and press new u-joints in. Grease all areas on assembly.	
75W90 Synthetic Gear Oil	3.00	23.96	71.88	Upper And Lower Ball Joints	868.34
Shop Supplies			116.78	While wheel ends were apart for wheel bearings and axle u-joints, remove and replace ball joints with new updated HD housing style grease able ball joint.	
				Front Steering Dampener	133.59
				Replace steering dampener with new updated unit, adjust to proper left and right swing.	
				Hazardous Materials	9.67

Email Address: [northeastdiesel@outlook.com](mailto:northeastdiesel@outlook.com)



**Northeast Diesel LLC**

319 Route 81 Bldg B

Killingworth, CT. 06419

Phone: 860-575-2642 Fax: 860-452-4481

'YOUR POWER IS OUR PASSION'

**INVOICE****3538**

Org. Est. # 003538

**P.2**

Printed Date: 05/18/2023

**INVOICE****Killingworth Amb. - James Fretz**

PO Box 749

Killingworth, CT 06419

Home 203-421-4040 James 860-759-0196

Office 203-710-2456 Dan

2009 Dodge - Ram - 4500 - Cummins 6.7L ETJ 6 CYL

Lic # : AB30174

Odometer In : 116569

VIN # : 3D6WD66L5 9G542636

Part Description	Qty	Sale	Ext	Labor Description	Ext
------------------	-----	------	-----	-------------------	-----

Org. Estimate 7,606.71 Revisions 0.00 Current Estimate 7,606.71

Labor:	3,008.46
Parts:	4,588.58
HazMat:	9.67
SubTotal:	7,606.71
Tax:	0.00
Total:	7,606.71
Bal Due:	\$7,606.71

[ Payments - ]

Vehicle Received:

Customer Number : 145

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the vehicle described for testing and/or inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. SMOG: I understand that I can have emission service and/or adjustments done elsewhere. I hereby waive this right.

PAYMENT: Will be collected for truck repair upon receiving invoice, unless otherwise discussed with customer and owner before work is started and completed, 30 day house accounts for towns and other non profit organizations and contractors can be opened upon approval of owner prior to repair.

WARRANTY: The warranty on the work done this facility is covered for 1 year parts and labor, if a customer provides there own parts, the labor warranty is void and is NOT covered if the part fails, labor warranty is only covered if the part is purchased in house.

Part and Truck Disclaimers: All Parts removed will be discarded unless instructed otherwise. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO TRUCK OR ARTICLES LEFT IN TRUCKS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Signature \_\_\_\_\_ Date 5-18-2023Email Address: [northeastdiesel@outlook.com](mailto:northeastdiesel@outlook.com)



# STATE OF CONNECTICUT

TO: DEPARTMENT OF MOTOR VEHICLES

FROM: DEPARTMENT OF PUBLIC HEALTH

RE: EMS MOTOR VEHICLE REGISTRATION

DEPARTMENT OF PUBLIC HEALTH  
Office of Emergency Medical Services  
410 Capitol Avenue, MS#12EMS  
P.O. Box 340308  
Hartford, CT 06134-0308  
Telephone: 860-509-7975

This vehicle, Vehicle Identification Number (VIN) 3D6WD66L59G542636

Has been inspected and successfully met the minimal equipment requirements as stated in Chapter 368d, of the Connecticut General Statutes, as amended, and may, therefore, be registered by your department for a (New ☐ Transfer ☐ Renewal ☒

Registration # AB30174

Inspector, OEMS 5/18/2023

Inspector, OEMS

Provider Signature

5-18-2023

Date

COMPANY NAME (NOT LESSEE) <u>Killingworth Ambulance</u>			
ADDRESS (No. and Street) <u>P.O. Box 749</u>		(CITY OR TOWN) <u>Killingworth</u>	(STATE) <u>CT</u>
MARKER PLATE <u>AB 30174</u>		MAKE OF VEHICLE <u>Dodge</u>	MODEL <u>4500</u>
VEHICLE IDENTIFICATION NUMBER <u>3D6WD66L59G542636</u>		YEAR <u>2009</u>	BODY STYLE (Sedan, Modular, Van) <u>116569</u>
TYPE OF VEHICLE <input checked="" type="checkbox"/> Ambulance <input type="checkbox"/> Invalid Coach			

Instructions: Mark column entries to verify inspection.

VEHICLE COMPONENTS INSPECTED		
Item	Pass	Fail
Brake System	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Service Brakes	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Hydraulic/Air	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Parking Brakes/System	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Brake Rotors/Drums	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Brake Hose	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Brake Tubing	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Exhaust System	<input checked="" type="checkbox"/>	<input type="checkbox"/>
No part of the exhaust system of any motor vehicle shall be so located as would be likely to result in burning, charring or damaging the electrical wiring, the fuel supply or any combustible part of the motor vehicle.		
Any exhaust system determined to be leaking at a point forward of or directly below the driver compartment	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Windshield Glazing	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Requirements and exceptions as stated pertaining to any crack, discoloration or vision reducing matter (reference 393.60 for exception)		
Windshield Wipers	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Any power unit that has an inoperative wiper or missing or damaged parts that render it ineffective		

VEHICLE COMPONENTS INSPECTED		
Item	Pass	Fail
Fuel System	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Visible Leak	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Fuel Tank Filler Cap Missing	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Fuel Tank Securely Attached	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Lighting Devices	<input checked="" type="checkbox"/>	<input type="checkbox"/>
All lighting devices and reflectors required by Section 393.11 shall be operable		
Safe loading	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Part(s) of vehicle or conditions of loading such that the spare tire or any part of the load or damage can fall onto the roadway.		
Mirrors	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Seat Belts	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Horn	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Muffler	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Wiring	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Heater/Defroster	<input checked="" type="checkbox"/>	<input type="checkbox"/>
LIST ANY OTHER CONDITION WHICH MAY PREVENT SAFE OPERATION OF THIS VEHICLE.		

VEHICLE COMPONENTS INSPECTED		
Item	Pass	Fail
Steering Mechanism	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Steering Wheel Free Play	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Front cable beam and All steering components other than steering column	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Steering Gear Box	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Pitman Arm	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Power Steering	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Ball and Socket Joints	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tie Rods and Drag links	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Nuts/Cotter Pin	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Steering System	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Suspension	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Any U-bolt, spring, hangers other axle positioning part(s) cracked, broken, loose or missing resulting in shifting of an axle from its normal position	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Spring Assembly	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Torque, Radius or tracking components	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Frame	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Frame members	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tires	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tires on any steering axle of a power unit	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Tire and Wheel clearance	<input checked="" type="checkbox"/>	<input type="checkbox"/>
All other tires	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Wheels and Rims	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Wheels and rims	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Fasteners	<input checked="" type="checkbox"/>	<input type="checkbox"/>
Welds	<input checked="" type="checkbox"/>	<input type="checkbox"/>

CERTIFICATION THIS VEHICLE HAS PASSED ALL INSPECTION ITEMS FOR THE BIENNIAL VEHICLE INSPECTION REPORT IN ACCORDANCE WITH 49 CFR 396.17

DEALER/REPAIRER NAME <u>Northeast Diesel</u>		DEALER/REPAIRER LICENSE NUMBER <u>R7464</u>	INSPECTOR NAME (print or type) <u>Travis Sierpinski</u>
INITIAL INSPECTION	INITIAL INSPECTION RESULTS <input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL	AUTHORIZED SIGNATURE OF DEALER/REPAIRER <u>X</u>	
RE-INSPECTION	INSPECTION RESULTS <input checked="" type="checkbox"/> PASS <input type="checkbox"/> FAIL	AUTHORIZED SIGNATURE OF DEALER/REPAIRER <u>X</u>	

WHITE: (Original) Motor Vehicle Registry/EMS Provider

CANARY: (Duplicate) OEMS

GOLD: (Triplicate) Vehicle Inspector



Eastford Fire & Rescue Sales, Inc.

10 Westford Road  
PO Box 68  
Eastford, CT 06242  
860/974-1718  
860/974-3564 FAX

Check # 5941  
Date Paid 4/19/22  
Approved By Beloy D  
Acct. Charged Ambulance  
maint

# Invoice

Date	Invoice #
4/11/2022	22367

Bill To
Killingworth Ambulance P.O. Box 749 Pond Meadow Road Killingworth, CT 06419

325 R. 81

P.O. No.	Terms	Unit#	Mileage
	Net 30	559	103,755

Item	Qty	Description	Rate	Amount
903-450	2.5	Service truck- change oil and filter, check gear oil levels, lights and tires. Inspect brakes and grease truck.	149.00	372.50
LF 3972	1	Filter	23.82	23.82
15W40/Bulk	13	15W40 oil/quart	8.80	114.40
194	1	light bulb	2.06	2.06
450	1	Removed and replaced both rear entry door outside handles.	149.00	149.00
Hand-850FFAC	1	handle	152.25	152.25
Handle-800LRC	1	Handle	125.85	125.85
Freight Charge	1	Freight Charge	22.28	22.28
shop sup	1	Shop Supplies and Waste Disposal Fee	8.50	8.50
Pick up and Deli...	1	No charge for pick up and delivery	0.00	0.00

**Subtotal** \$970.66

**Sales Tax (6.35%)** \$0.00

**Payments/Credits** -\$0.01

**Balance Due** \$970.65

Please remit to: PO Box 68 Eastford, CT 06242

A service charge of 1.5% will be charged on the unpaid balance beginning 30 days from the original invoice date. Customer agrees to pay reasonable attorney fees and cost incurred in collection.



# Invoice

**OASIS**

**OASIS TRUCK TIRE SERVICE, LLC**  
231 LEDYARD STREET  
HARTFORD, CT 06114-2006  
(860) 296-8749

DATE

INVOICE #

11/2/2022

E41124

BILL TO:

SHIP TO:

KILLINGWORTH AMBULANCE  
P O BOX 749  
KILLINGWORTH CT 06419

P.O. NUMBER	TERMS	REP	SHIP	VIA	F.O.B.	PROJECT
UNIT#84	Net 30	DL	11/2/2022			
QUANTITY	ITEM CODE	DESCRIPTION			PRICE EACH	AMOUNT
6	225195CONTHDR...	225/70R19.5 CONTI HDR+ TL G			440.46	2642.76
6	XMI	DISMT/MOUNT/INSTALL TRUCK TL			30.00	180.00
6	COMBAL	COMPUTER TRUCK BALANCE			25.00	150.00
6	SCRMED	SCRAP DISPOSAL OF MEDIUM TRK 19.5			10.00	60.00

PLR BOSS

Trans

Oasis Tire	225/70R 19.5 Load 6 in PSI
Michelin XDS2	466.46 ea.
Continental HDR+	440.46 ea.
m+B	25.00 ea.
Balance	30.00 ea.

AL

\$3,194.6

3032.76